


# NMD50 – Communication Problems



1. Verify all cables and wires are connected and not cut/broken.
2. Ensure that the gray COM cable plug is fully inserted into the white connector on the NMD50 (There should be ***no gap*** between the plug and the socket). To reseal, remove the cable from the white connector by pulling on the wires and “wiggling” it out. Then reconnect and gently push in with a small screwdriver.

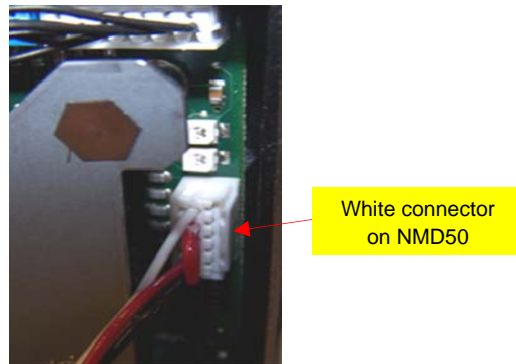

3. Unplug and Plug in again the gray COM Cable quick disconnect – Check connector wiring on both sides
4. Unplug and reseal the COM 4 Serial Cable in the Upper Left Cabinet behind the Monitor

